

SKODA												
1.0 AQR ARV	37 kW (50 PS)	FABIA	12/99-08/02	02-36085-01 <sup>12</sup> 08-36087-01 <sup>13</sup>	61-36085-00 047 103 383 B 73.5 Ø 	14-32167-01 N 907 957 01 (5x) +N 907 958 01 (4x) +N 907 956 01 (1x) 	71-36056-00 047 103 483 	12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675 8x 	71-36084-00 047 129 717 B 2x 	71-36086-00 047 253 050 71-36723-00 R 047 253 039 H 71-36724-00 L 047 253 039 J 	71-36087-00 047 103 609 B 	81-36787-00 K ← 047 103 085 42x58x8 A SL RD FPM 81-36788-00 K → 047 103 085 A 85x105x12 A SL LD FPM
1.0 CHYA CHYB	44-55 kW (60-75 PS)	CITIGO	10/11→	01-37675-01 <sup>12</sup> <sup>13</sup> <sup>38</sup>  02-37675-01 <sup>12</sup> 	61-37675-00 04C 103 383 H 75.5 Ø MLS 	14-32385-02 WHT 004 926 (8x) 	71-39983-00 04C 103 483 B →04/13  71-39983-10 04C 103 483 E 05/13→ 	12-42741-02 04E 109 675 (6x) +04E 109 675 A (6x) 70-42741-00 ES 04E 109 675 70-42742-00 AS 04E 109 675 A 6x 6x	41-77647-00 04C 129 717 B 6x 71-34204-00 036 129 717 E 3x 	71-10021-00 1S0 253 115 B 	70-31414-10 	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM
1.0 CHYA CHYB	44-55 kW (60-75 PS)	FABIA	08/14→	01-37675-01 <sup>12</sup> <sup>13</sup> <sup>38</sup>  02-37675-01 <sup>12</sup> 	61-37675-00 04C 103 383 H 75.5 Ø MLS 	14-32385-02 WHT 004 926 (8x) 	71-39983-10 04C 103 483 E 	12-42741-02 04E 109 675 (6x) +04E 109 675 A (6x) 70-42741-00 ES 04E 109 675 70-42742-00 AS 04E 109 675 A 6x 6x	41-77647-00 04C 129 717 B 6x 71-34204-00 036 129 717 E 3x 	71-10021-00 1S0 253 115 B 	70-31414-10 	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM
1.0 CPGA	50 kW (68 PS)	CITIGO	11/12→	01-37835-01 <sup>12</sup> <sup>13</sup> <sup>38</sup>  02-37835-01 <sup>12</sup> 	61-37835-00 04C 103 383 N 75.5 Ø MLS 	14-32385-02 WHT 004 926 (8x) 	71-39983-00 04C 103 483 B →04/13  71-39983-10 04C 103 483 E 05/13→ 	12-42742-01 04E 109 675 A (12x) 70-42742-00 04E 109 675 A 12x	41-77647-00 04C 129 717 B 12x 71-34204-00 036 129 717 E 3x 	71-10021-00 1S0 253 115 B 	70-31414-10 	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM

SKODA													
1,2 AWY BMD	40 kW (54 PS)	FABIA	→6Y 5 280 000	07/01-03/08	02-36050-01 <sup>12</sup> 08-36942-01 <sup>13</sup>	61-36050-00 03D 103 383 G 77 Ø 0,6 mm MLS 	14-32123-02 WHT 001 808 (8x) 	70-31414-10 	12-31306-13 036 109 675 (6x) 70-31306-00 036 109 675 6x	71-36066-00 03D 129 717 A 3x 	71-36101-00 03D 253 039 B 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
1,2 AWY BMD	40 kW (54 PS)	FABIA	6Y 5 280 001→	07/01-03/08	02-36050-01 <sup>12</sup> 08-36942-01 <sup>13</sup>	61-36050-00 03D 103 383 G 77 Ø 0,6 mm MLS 	14-32123-02 WHT 001 808 (8x) 	70-31414-10 	12-31306-13 036 109 675 (6x) 70-31306-00 036 109 675 6x	40-77570-00 03D 129 717 B 3x 	71-36101-00 03D 253 039 B 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
1,2 AZQ BME BZG CEVA CGPA CGPB CGPC CHTA CJLA	44-55 kW (60-75 PS)	FABIA RAPID ROOMSTER		01/03→	02-36045-01 <sup>12</sup> 08-36942-01 <sup>13</sup>	61-36045-00 03E 103 383 F 77 Ø 0,9 mm MLS 	14-32120-02 036 103 384 B (8x) 	70-31414-10 	12-31306-08 036 109 675 (12x) 70-31306-00 036 109 675 12x	40-77557-00 03E 129 717 B 3x 	71-36102-00 03E 253 039 A 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
1,2 BBM CHFA	44 kW (60 PS)	FABIA		12/06-12/14	02-36050-01 <sup>12</sup> 08-36942-01 <sup>13</sup>	61-36050-00 03D 103 383 G 77 Ø 0,6 mm MLS 	14-32123-02 WHT 001 808 (8x) 	70-31414-10 	12-31306-13 036 109 675 (6x) 70-31306-00 036 109 675 6x	40-77570-00 03D 129 717 B 3x 	71-36101-00 03D 253 039 B 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM
1,2 CBZA CBZB	63-77 kW (86-105 PS)	FABIA TSI OCTAVIA TSI PRAKTIK TSI RAPID RAPID TSI ROOMSTER TSI YETI TSI		09/09→	02-36650-01  08-40846-01 <sup>13</sup> <sup>35</sup>	61-36650-00 03F 103 383 E 72 Ø MLS 	14-32323-01 WHT 004 790 (10x) 	70-31414-10  71-40101-00 X 03F 103 483 A Metall 	12-31306-07 036 109 675 (8x) 70-31306-00 036 109 675 8x	71-40531-00 03F 129 717 4x  71-40534-00 03F 129 717 A 1x 	71-40498-00 03F 253 041 P 	70-31414-10 	81-34367-00 K ← 038 103 085 A 32x47x10 A SL RD PTFE ACM 81-90059-00 K → 036 103 171 B PTFE

SKODA														
1,2 CFWA	55 kW (75 PS)	FABIA TDI PRAKTIK TDI ROOMSTER TDI	03/10-05/15	<b>02-40508-01</b> <sup>12</sup> <b>08-40849-01</b> <sup>14</sup>	<b>61-37820-00</b> 03P 103 383 C 82 Ø 1,55 mm 1 MLS <b>61-37820-10</b> 03P 103 383 D 82 Ø 1,63 mm 2 MLS <b>61-37820-20</b> 03P 103 383 E 82 Ø 1,71 mm 3 MLS	<b>14-32299-02</b> WHT 002 131 (8X) 	<b>71-40508-00</b> 03P 103 483 	<b>12-31306-08</b> 036 109 675 (12x) <b>70-31306-00</b> 036 109 675	<b>71-40479-00</b> 03P 129 717 12x		<b>71-40499-00</b> 03P 253 039 	<b>70-31414-10</b> 	<b>81-40538-00 N</b> 03L 103 085 32x47x10 ARD FPM	
1,2 CJZA CJZB <b>[NEW]</b>	63-77 kW (86-105 PS)	CS540 TSI OCTAVIA TSI	11/12→	<b>02-37805-01</b> <sup>12</sup> <b>08-42961-01</b> <sup>13 38</sup>	<b>61-37805-00</b> 04E 103 383 T 72 Ø MLS 	<b>14-32385-01</b> WHT 004 926 (10x) 	<b>71-42813-00</b> 04E 103 483 H 	<b>12-42741-01</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>70-42741-00 ES</b> 04E 109 675 <b>70-42742-00 AS</b> 04E 109 675 A	<b>71-34204-00</b> 036 129 717 E 4x 		<b>71-42802-00</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>81-42697-00 K</b> ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>81-90082-00 K</b> → 04E 103 170 A PTFE <b>81-42736-00 N</b> ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>81-42734-00 N</b> → 04E 103 085 24x39x8 A SL LD PTFE ACM	
1,2 CJZC CJZD <b>[NEW]</b>	66-81 kW (90-110 PS)	FABIA TSI RAPID TSI	08/14→	<b>02-37805-01</b> <sup>12</sup> <b>08-42961-01</b> <sup>13 38</sup>	<b>61-37805-00</b> 04E 103 383 T 72 Ø MLS 	<b>14-32385-01</b> WHT 004 926 (10x) 	<b>71-42813-00</b> 04E 103 483 H 	<b>12-42741-01</b> 04E 109 675 (8x) +04E 109 675 A (8x) <b>70-42741-00 ES</b> 04E 109 675 <b>70-42742-00 AS</b> 04E 109 675 A	<b>71-34204-00</b> 036 129 717 E 4x 		<b>71-42802-00</b> 04E 253 039 D 	<b>70-31414-10</b> 	<b>81-42697-00 K</b> ← 04C 103 085 30x40x7 A SL RD PTFE ACM <b>81-42736-00 N</b> ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM <b>81-42734-00 N</b> → 04E 103 085 24x39x8 A SL LD PTFE ACM	
1,3 135/8 136 L	43-45 kW (58-61 PS)	FAVORIT 136 RAPID 130	09/84-09/94	<b>01-27180-02</b> <sup>12 13</sup> <b>02-27180-02</b> <sup>12</sup>	<b>61-27180-10</b> 114-092854 77 Ø 1,5 mm 		<b>71-36056-00</b> 047 103 483 	<b>12-22737-01</b> 113-028540 (8x) <b>70-22737-00</b> 113-028540	8x 		<b>71-27203-10</b> <sup>7</sup> 114-095840 	<b>71-13061-00</b> 113-090920 	<b>81-26269-00 K</b> ← 42x58x11 A SL RD FPM <b>81-23708-40 K</b> → 068 103 051 P 85x105x11 A SL LD FPM	
1,4 AME AQW ATZ AZE AZF	44-50 kW (60-68 PS)	FABIA	08/99-05/03	<b>02-36205-01</b> <sup>12</sup> <b>08-36087-01</b> <sup>13</sup>	<b>61-36205-00</b> 047 103 383 J 	<b>14-32167-01</b> N 907 957 01 (5x) +N 907 958 01 (4x) +N 907 956 01 (1x) 	<b>71-36056-00</b> 047 103 483 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	8x 		<b>71-36769-00</b> 047 129 717 E 2x 	<b>71-36086-00</b> 047 253 050 <b>71-36723-00 R</b> 047 253 039 H <b>71-36724-00 L</b> 047 253 039 J 	<b>70-31414-10</b> 	<b>81-36787-00 K</b> ← 047 103 085 42x58x8 A SL RD FPM <b>81-36788-00 K</b> → 047 103 085 A 85x105x12 A SL LD FPM

SKODA												
Ltr.	Power	Model	Period	Part No.	Part No.	Part No.	Part No.	Part No.	Part No.	Part No.	Part No.	Part No.
1,4 AMF	55 kW (75 PS)	FABIA TDI	04/03-03/08	02-35128-01 <sup>12</sup>  08-36871-01 <sup>13 38</sup>	61-31855-00 045 103 383 AA 80,5 Ø 1,45 mm 1 <input type="checkbox"/> MLS 61-31855-10 045 103 383 AB 80,5 Ø 1,53 mm 2 <input type="checkbox"/> MLS 61-31855-20 045 103 383 AC 80,5 Ø 1,61 mm 3 <input type="checkbox"/> MLS 	14-32121-02 038 103 384 (8x) 	71-37574-00 045 103 483 C 	12-26058-05 027 109 675 (6x) 70-26058-00 027 109 675	71-34221-00 045 129 717 6x 	71-34217-00 045 253 039 71-33199-00 <sup>13</sup> 1H0 253 115 A 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90010-00 K → <sup>13</sup> 06A 103 171 A PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM
1,4 AUA AUB	55-74 kW (75-100 PS)	FABIA →6Y 2 366 084, 6Y 2X028 027	10/99-03/08	02-34075-01 <sup>12</sup> 08-34320-01 <sup>13 38</sup> 036 198 011	61-34075-00 036 103 383 AM 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E 16x 	71-34206-00 036 253 039 F 	70-31414-10 	81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM 81-90020-00 K → <sup>13</sup> 030 103 171 H PTFE 81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM
1,4 AXP	55 kW (75 PS)	OCTAVIA	08/00-12/10	02-34075-01 <sup>12</sup> 08-34320-01 <sup>13 38</sup> 036 198 011	61-34075-00 036 103 383 AM 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E 16x 	71-34206-00 036 253 039 F 	70-31414-10 	81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM 81-90020-00 K → <sup>13</sup> 030 103 171 H PTFE →12/01 81-90016-00 K → <sup>13</sup> 030 103 171 K PTFE 01/02→ 81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM
1,4 BBY BBZ BKY	55-74 kW (75-100 PS)	FABIA	10/99-03/08	02-34075-01 <sup>12</sup> 08-34320-01 <sup>13 38</sup> 036 198 011	61-34075-00 036 103 383 AM 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E 16x 	71-34206-00 036 253 039 F 	70-31414-10 	81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM 81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM
1,4 BCA	55 kW (75 PS)	OCTAVIA	08/00-12/10	02-34075-01 <sup>12</sup> 08-34320-01 <sup>13 38</sup> 036 198 011	61-34075-00 036 103 383 AM 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E 16x 	71-34206-00 036 253 039 F 	70-31414-10 	81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM 81-90016-00 K → <sup>13</sup> 030 103 171 K PTFE 81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM

SKODA												
1,4 BMS	59 kW (80 PS)	FABIA TDI ROOMSTER	09/06-03/10	<p>02-37573-01 <sup>12</sup></p> <p>08-36871-01 <sup>13 38</sup></p>	<p>61-31855-00 045 103 383 AA 80,5 Ø 1,45 mm 1 </p> <p>MLS</p> <p>61-31855-10 045 103 383 AB 80,5 Ø 1,53 mm 2 </p> <p>MLS</p> <p>61-31855-20 045 103 383 AC 80,5 Ø 1,61 mm 3 </p> <p>MLS</p>	<p>14-32121-02 038 103 384 (8x)</p>	<p>71-37573-00 045 103 483 E</p>	<p>12-26058-05 027 109 675 (6x)</p> <p>70-26058-00 027 109 675</p>	<p>6x</p> <p>71-34221-00 045 129 717</p>	<p>71-37532-00 045 253 039 B</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
1,4 BNM BNV	51-59 kW (70-80 PS)	FABIA TDI ROOMSTER	10/05-03/10	<p>02-37574-01 <sup>12</sup></p> <p>08-36871-01 <sup>13 38</sup></p>	<p>61-31855-00 045 103 383 AA 80,5 Ø 1,45 mm 1 </p> <p>MLS</p> <p>61-31855-10 045 103 383 AB 80,5 Ø 1,53 mm 2 </p> <p>MLS</p> <p>61-31855-20 045 103 383 AC 80,5 Ø 1,61 mm 3 </p> <p>MLS</p>	<p>14-32121-02 038 103 384 (8x)</p>	<p>71-37574-00 045 103 483 C</p>	<p>12-26058-05 027 109 675 (6x)</p> <p>70-26058-00 027 109 675</p>	<p>6x</p> <p>71-34221-00 045 129 717</p>	<p>71-34217-00 045 253 039</p> <p>71-33199-00  1H0 253 115 A</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90010-00 K →  06A 103 171 A PTFE</p> <p>81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
1,4 BUD BXW	59-63 kW (80-86 PS)	FABIA OCTAVIA ROOMSTER	06/04-05/15	<p>02-34075-01 <sup>12</sup></p> <p>08-34320-01 <sup>13 38</sup> 036 198 011</p>	<p>61-34075-00 036 103 383 AM 77,5 Ø MLS</p>	<p>14-32120-01 036 103 384 B (10x)</p>	<p>70-31414-10</p>	<p>12-31306-12 036 109 675 (16x)</p> <p>70-31306-00 036 109 675</p>	<p>16x</p> <p>71-34204-00 036 129 717 E</p>	<p>71-34206-00 036 253 039 F</p>	<p>70-31414-10</p>	<p>81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM</p> <p>81-90021-00 K →  030 103 171 S PTFE</p> <p>81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM</p>
1,4 CAVE CAXC CFB CTHE	92-132 kW (125-180 PS)	FABIA TSI SUPERB TSI	07/08→	<p>01-37045-01 <sup>12 13 38</sup></p>	<p>61-37045-00 03C 103 383 AM 77,5 Ø MLS</p>	<p>14-32277-01 WHT 000 912 (10x)</p>	<p>70-31414-10</p>	<p>12-31306-12 036 109 675 (16x)</p> <p>70-31306-00 036 109 675</p>	<p>16x</p> <p>71-36116-00 03C 129 717 C</p> <p>71-36068-00 <sup>10</sup> 4x 03C 129 717 A</p>	<p>71-36122-00 03C 253 039 D</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90059-00 K →  036 103 171 B PTFE</p>
1,4 CAXA	90 kW (122 PS)	OCTAVIA TSI RAPID TSI YETI TSI	11/08→	<p>01-37045-01 <sup>12 13 38</sup></p>	<p>61-37045-00 03C 103 383 AM 77,5 Ø MLS</p>	<p>14-32277-01 WHT 000 912 (10x)</p>	<p>70-31414-10</p>	<p>12-31306-12 036 109 675 (16x)</p> <p>70-31306-00 036 109 675</p>	<p>16x</p> <p>71-36116-00 03C 129 717 C</p> <p>71-36068-00 <sup>10</sup> 4x 03C 129 717 A</p>	<p>71-36122-00 03C 253 039 D</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90059-00 K →  036 103 171 B PTFE</p> <p>Mot.CAXA 010 452→</p>

SKODA												
Ltr.												
1,4 CDDA <b>[NEW]</b>	63 kW (86 PS)		<b>1</b>									
				01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS 	14-32330-01 WHT 000 675 (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x		71-40541-00 03C 253 039 E 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM
1,4 CFBA <b>[NEW]</b>	96 kW (131 PS)			01-37045-01 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS 	14-32277-01 WHT 000 912 (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-36116-00 03C 129 717 C  71-36068-00 <sup>10</sup> 03C 129 717 A 4x	71-36122-00 03C 253 039 D 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM
1,4 CGGA CGGB <b>[NEW]</b>	59-63 kW (80-86 PS)	FABIA OCTAVIA ROOMSTER	06/04-05/15	02-34075-01 <sup>12</sup> 08-34320-01 <sup>13</sup> <sup>38</sup> 036 198 011	61-34075-00 036 103 383 AM 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-34204-00 036 129 717 E 4x 	71-34206-00 036 253 039 F 	70-31414-10 	81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM 81-90059-00 K → 036 103 171 B PTFE 81-34226-00 N 2x 036 103 085 A 27x42x8 A SL RD FPM
1,4 CHPA CPWA <b>[NEW]</b>	81-103 kW (110-140 PS)	OCTAVIA TSI	11/12→	02-37800-01 <sup>12</sup> 08-42961-01 <sup>13</sup> <sup>38</sup>	61-37800-00 04E 103 383 BJ 75 Ø MLS 	14-32385-01 WHT 004 926 (10x) 	71-42813-00 04E 103 483 H 	12-42741-01 04E 109 675 (8x) +04E 109 675 A (8x) 70-42741-00 ES 04E 109 675 70-42742-00 AS 04E 109 675 A 8x 8x	71-34204-00 036 129 717 E 4x 	71-42802-00 04E 253 039 D 	70-31414-10 	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-90082-00 K → 04E 103 170 A PTFE 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM
1,4 CLPA <b>[NEW]</b>	63 kW (85 PS)			01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS 	14-32330-01 WHT 000 675 (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-34204-00 036 129 717 E 4x 	71-40541-00 03C 253 039 E 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90059-00 K → 036 103 171 B PTFE
1,4 CSSA CSTA <b>[NEW]</b>	96-110 kW (131-150 PS)				61-38170-00 04E 103 383 BF 75 Ø MLS 	14-32385-01 WHT 004 926 (10x) 	71-42813-00 04E 103 483 H 	12-42741-01 04E 109 675 (8x) +04E 109 675 A (8x) 70-42741-00 ES 04E 109 675 70-42742-00 AS 04E 109 675 A 8x 8x	71-34204-00 036 129 717 E 4x 	71-42802-00 04E 253 039 D 	70-31414-10 	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM

SKODA													
Ltr.													
1,6 AEE 55 kW (75 PS) FELICIA OCTAVIA	08/95-09/04	02-31970-02 <sup>12</sup> 032 198 012 B 08-31414-02 <sup>13</sup> 030 198 011 A Mot.→AEE 562 757  08-34325-01 <sup>13 35</sup> Mot.AEE 562 758→	61-31970-00 030 103 383 AH 77,5 Ø 0,5 mm MLS 	14-32051-01 032 103 384 (10x) 	15-31693-01 030 103 483 K +030 103 533 F (3x) 	12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675	11-77542-01 030 198 717 8x 		71-31046-00 032 253 039 E 	70-31414-10 	81-19299-10 K ← 068 103 085 E 32x47x10 A SL WD FPM Mot.→AEE 562 757 81-34227-00 K ← 036 103 085 H 32x42x6 A SL RD FPM Mot.AEE 562 758→ 81-23708-40 K → 068 103 051 P 85x105x11 A SL LD FPM Mot.→AEE 562 757 81-90000-00 K → 028 103 171 B Mot.AEE 562 758→ 81-19299-10 N 068 103 085 E 32x47x10 A SL WD FPM		
1,6 AEH AKL	74 kW (101 PS) OCTAVIA	02/97-12/07	02-31280-01 <sup>12</sup> 06A 198 012 08-35053-01 <sup>13 38</sup> 06A 198 011	61-31280-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	14-32126-01 06A 103 384 C (10x) 	71-31691-00 051 103 483 A 2 Dichtlippen 	12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675	71-34203-00 06A 133 398 F 4x 	71-31957-00 037 253 039 D 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90006-00 K → 06B 103 171 B PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM		
1,6 AVU BFQ	75 kW (102 PS) OCTAVIA	09/00-12/10	02-31280-05 <sup>12</sup> 08-35053-02 <sup>13 35</sup>	61-31280-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	14-32126-01 06A 103 384 C (10x) 	71-34096-00 06B 103 483 L 	12-31306-07 036 109 675 (8x) 70-31306-00 036 109 675	71-34203-00 06A 133 398 F 4x 	71-34216-00 06A 253 039 L 71-27331-30 533 253 115 D 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90006-00 K → 06B 103 171 B PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM		
1,6 BGU BSE BSF	75 kW (102 PS) OCTAVIA	06/04-06/13	02-31280-05 <sup>12</sup> 08-35053-03 <sup>13 35</sup>	61-31280-00 06B 103 383 H 82,5 Ø 1,2 mm MLS 	14-32126-01 06A 103 384 C (10x) 	71-34096-00 06B 103 483 L 	12-31306-07 036 109 675 (8x) 70-31306-00 036 109 675	71-34203-00 06A 133 398 F 4x 	71-36061-00 <sup>10</sup> 06A 133 227 B 4x 	71-34216-00 06A 253 039 L 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90006-10 K → 06B 103 171 E 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,6 BLF	85 kW (115 PS) OCTAVIA FSI	02/04-10/08	01-34280-01 <sup>12 13 35</sup> 02-34280-01 <sup>12</sup>	61-34280-00 03C 103 383 D 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-01 036 109 675 (16x) 70-31306-00 036 109 675	16x 71-36116-00 03C 129 717 C 71-36068-00 <sup>10</sup> 03C 129 717 A 4x 	71-36122-00 03C 253 039 D 71-34148-00 1J0 253 115 S 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90021-00 K → 030 103 171 S PTFE		

SKODA															
1,6 BTS	77 kW (105 PS)	FABIA ROOMSTER	09/06-05/15		<b>61-34280-02</b> <sup>12</sup> <sup>13</sup> <sup>35</sup>	<b>61-34280-00</b> 03C 103 383 D 77,5 Ø MLS 	<b>14-32120-01</b> 036 103 384 B (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675	16x 	<b>71-34204-00</b> 036 129 717 E	4x	<b>71-36122-00</b> 03C 253 039 D 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM
1,6 CAYA CAYB CAYC	55-77 kW (75-105 PS)	FABIA TDI RAPID RAPID TDI ROOMSTER TDI SUPERB TDI YETI TDI	03/10→	  <b>08-40847-01</b> <sup>13</sup> <sup>35</sup>	<b>61-36360-00</b> 03L 103 383 BQ 80,5 Ø 1,55 mm 1 □ MLS <b>61-36360-10</b> 03L 103 383 BR 80,5 Ø 1,63 mm 2 □ MLS <b>61-36360-20</b> 03L 103 383 BS 80,5 Ø 1,71 mm 3 □ MLS 	<b>14-32299-01</b> WHT 002 131 (10x) 	<b>15-40484-01</b> 03L 103 483 H +03L 103 070 A (4x)  <b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)  <b>71-40484-00</b> 03L 103 483 H  <b>71-40486-00</b> 03L 103 483 C 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675	16x 	<b>71-40514-00</b> 03L 129 717 J  <b>71-40524-00</b> 03L 129 717 H 	4x  4x	<b>71-37422-00</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90052-00 K</b> → 03L 103 171 A PTFE <b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM	
1,6 CAYC	77 kW (105 PS)	OCTAVIA TDI	06/09-04/13	  <b>08-40847-01</b> <sup>13</sup> <sup>35</sup>	<b>61-36360-00</b> 03L 103 383 BQ 80,5 Ø 1,55 mm 1 □ MLS <b>61-36360-10</b> 03L 103 383 BR 80,5 Ø 1,63 mm 2 □ MLS <b>61-36360-20</b> 03L 103 383 BS 80,5 Ø 1,71 mm 3 □ MLS 	<b>14-32299-01</b> WHT 002 131 (10x) 	<b>15-40484-01</b> 03L 103 483 H +03L 103 070 A (4x)  <b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)  <b>71-40484-00</b> 03L 103 483 H  <b>71-40486-00</b> 03L 103 483 C 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675	16x 	<b>71-40514-00</b> 03L 129 717 J  <b>71-40524-00</b> 03L 129 717 H 	4x  4x	<b>71-37422-00</b> 03L 253 039 E 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90052-00 K</b> → 03L 103 171 A PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM →09/09 <b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM 10/09→	
1,6 CCSA CHGA CMXA	75 kW (102 PS)	OCTAVIA	06/04-06/13	<b>02-31280-05</b> <sup>12</sup> <b>08-35053-02</b> <sup>13</sup> <sup>35</sup>	<b>61-31280-00</b> 06B 103 383 H 82,5 Ø 1,2 mm MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-34096-00</b> 06B 103 483 L 	<b>12-31306-07</b> 036 109 675 (8x) <b>70-31306-00</b> 036 109 675	8x 	<b>71-34203-00</b> 06A 133 398 F	4x	<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90006-00 K</b> → 06B 103 171 B PTFE <b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM	



SKODA												
1.6 CDE CDEA CDF CDFA <b>[NEW]</b>	77 kW (105 PS)											
Ltr.				01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS 	14-32330-01 WHT 000 675 (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x		71-40541-00 03C 253 039 E 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM
1.6 CFNA	77 kW (105 PS)	FABIA RAPID ROOMSTER	09/06→	01-34280-02 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-34280-00 03C 103 383 D 77,5 Ø MLS 	14-32120-01 036 103 384 B (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-34204-00 036 129 717 E 4x 	71-36122-00 03C 253 039 D 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90059-00 K → 036 103 171 B PTFE
1.6 CLHA CLHB CRKB	66-81 kW (90-110 PS)	OCTAVIA TDI	11/12→	02-10002-01 <sup>12</sup>  	61-37840-00 04L 103 383 C 80,5 Ø 1,55 mm 1 MLS 61-37840-10 04L 103 383 D 80,5 Ø 1,63 mm 2 MLS 61-37840-20 04L 103 383 E 80,5 Ø 1,71 mm 3 MLS 	14-32384-01 WHT 005 673 (10x) 	15-10836-01 04L 103 483 +04L 103 070 A (4x)  15-42759-01 03L 103 483 S +04L 103 070 (4x)  71-10836-00 04L 103 483  71-42759-00 03L 103 483 S 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-42811-00 04L 129 717 B 	71-42816-00 04L 253 039 G 	70-31414-10 	81-42306-00 K → 04L 103 171 PTFE 81-40538-00 N 03L 103 085 32x47x10 A RD FPM
1.6 CLNA <b>[NEW]</b>	77 kW (105 PS)	RAPID RAPID TDI	07/12→	02-40983-01 <sup>12</sup>   08-40847-01 <sup>13</sup> <sup>35</sup>	61-36360-00 03L 103 383 BQ 80,5 Ø 1,55 mm 1 MLS 61-36360-10 03L 103 383 BR 80,5 Ø 1,63 mm 2 MLS 61-36360-20 03L 103 383 BS 80,5 Ø 1,71 mm 3 MLS 	14-32299-01 WHT 002 131 (10x) 	15-40486-01 03L 103 483 C +03L 103 070 (4x)  71-40486-00 03L 103 483 C 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-40514-00 03L 129 717 J 4x  71-40524-00 03L 129 717 H 4x 	71-37422-00 03L 253 039 E 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90052-00 K → 03L 103 171 A PTFE 81-40538-00 N 03L 103 085 32x47x10 A RD FPM
1.6 CLRA <b>[NEW]</b>	77 kW (105 PS)			01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS 	14-32330-01 WHT 000 675 (10x) 	70-31414-10 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675 16x	71-34204-00 036 129 717 E 4x 	71-40541-00 03C 253 039 E 	70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM

SKODA													
Ltr.	Power	Model	Year	Part 1	Part 2	Part 3	Part 4	Part 5	Part 6	Part 7	Part 8	Part 9	
1,6 CLSA	77 kW (105 PS)			01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS	14-32330-01 WHT 000 675 (10x)	70-31414-10	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E	4x	71-40541-00 03C 253 039 E	70-31414-10	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90059-00 K → 036 103 171 B PTFE
1,6 CPDA CSRA <b>[NEW]</b>	81 kW (110 PS)			02-10098-02 <sup>12</sup> 08-42961-01 <sup>13</sup> <sup>38</sup>	61-10098-00 04E 103 383 BK 77,5 Ø MLS	14-32385-01 WHT 004 926 (10x)	71-42813-00 04E 103 483 H	12-42741-01 04E 109 675 (8x) +04E 109 675 A (8x) 70-42741-00 ES 04E 109 675 70-42742-00 AS 04E 109 675 A	41-77647-00 04C 129 717 B	8x	71-42802-00 04E 253 039 D	70-31414-10	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM
1,6 CPJA <b>[NEW]</b>	77 kW (105 PS)			01-37045-03 <sup>12</sup> <sup>13</sup> <sup>38</sup>	61-37045-00 03C 103 383 AM 77,5 Ø MLS	14-32120-01 036 103 384 B (10x)	70-31414-10	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-34204-00 036 129 717 E	4x	71-40541-00 03C 253 039 E	70-31414-10	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM
1,6 CWVA <b>[NEW]</b>	81 kW (110 PS)	OCTAVIA YETI	01/14→	02-10098-01 <sup>12</sup> 08-42961-01 <sup>13</sup> <sup>38</sup>	61-10098-00 04E 103 383 BK 77,5 Ø MLS	14-32385-01 WHT 004 926 (10x)	71-42813-00 04E 103 483 H	12-42741-03 04E 109 675 (16x) 70-42741-00 04E 109 675	41-77647-00 04C 129 717 B	16x	71-42802-00 04E 253 039 D	70-31414-10	81-42697-00 K ← 04C 103 085 30x40x7 A SL RD PTFE ACM 81-42736-00 N ← 2x 04E 103 085 B 36x46x7 A SL RD PTFE ACM 81-42734-00 N → 04E 103 085 24x39x8 A SL LD PTFE ACM
1,8 ADR	92 kW (125 PS)			02-31955-01 <sup>12</sup> 08-31956-01 <sup>13</sup> 08-31956-02 <sup>13</sup> <sup>38</sup>	61-31955-10 058 103 383 Q 82,5 Ø MLS	14-32052-01 058 103 385 A (10x)	15-31946-01 058 198 025 A	12-31306-03 036 109 675 (20x) 70-31306-00 036 109 675	71-31986-00 058 129 717 B	20x	71-31958-00 058 253 039 L	70-31414-10 71-31956-00	81-19299-10 K ← 068 103 085 E 32x47x10 A SL WD FPM 81-23708-40 K → 068 103 051 P 85x105x11 A SL LD FPM 81-90000-00 K → 028 103 171 B 81-19299-10 N 068 103 085 E 32x47x10 A SL WD FPM
1,8 AGN	92 kW (125 PS)	OCTAVIA	→1U V 040 000 09/96-07/00	02-31955-02 <sup>12</sup> 06A 198 012 A 08-35054-01 <sup>13</sup> <sup>38</sup> 06A 198 011 A 15-34364-01 <sup>8</sup> 058 198 217	61-31955-10 058 103 383 Q 82,5 Ø MLS	14-32131-01 06A 103 385 C (10x) Mot.→AGN 107 000	15-31946-01 058 198 025 A	12-31306-03 036 109 675 (20x) 70-31306-00 036 109 675	71-31986-00 058 129 717 B	20x	71-31958-00 058 253 039 L 71-27331-30 533 253 115 D	70-31414-10	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90010-00 K → 06A 103 171 A PTFE 81-34367-00 N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM

SKODA													
Ltr.			<b>1</b>										
1,8 AGN	92 kW (125 PS)	OCTAVIA	1U W 000 001→ 09/96-07/00	<b>02-31955-03</b> <sup>12</sup> <b>08-35054-01</b> <sup>13 38</sup> 06A 198 011 A <b>15-34364-01</b> <sup>8</sup> 058 198 217	<b>61-31955-10</b> 058 103 383 Q 82,5 Ø MLS 	<b>14-32131-01</b> 06A 103 385 C (10x) Mot.→AGN 107 000  <b>14-32124-01</b> 06A 103 385 A (10x) Mot.AGN 107 001→ 	<b>15-31946-01</b> 058 198 025 A 	<b>12-31306-03</b> 036 109 675 (20x) <b>70-31306-00</b> 036 109 675 20x 	<b>71-34097-00</b> 06A 133 398 D 4x 	<b>71-31958-00</b> 058 253 039 L  <b>71-27331-30</b> <sup>Δ</sup> 533 253 115 D 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,8 AGU ARX ARZ AUM AUQ AWT	110-132 kW (150-180 PS)	OCTAVIA T SUPERB T	08/97-12/10	<b>02-31955-02</b> <sup>12</sup> 06A 198 012 A <b>08-35054-01</b> <sup>13 38</sup> 06A 198 011 A <b>15-34364-01</b> <sup>8</sup> 058 198 217	<b>61-31955-10</b> 058 103 383 Q 82,5 Ø MLS 	<b>14-32124-01</b> 06A 103 385 A (10x) 	<b>15-31946-01</b> 058 198 025 A 	<b>12-31306-03</b> 036 109 675 (20x) <b>70-31306-00</b> 036 109 675 20x 	<b>71-31986-00</b> 058 129 717 B 	<b>71-31958-00</b> 058 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM	
1,8 BZB	118 kW (160 PS)	OCTAVIA TSI SUPERB TSI	06/07-05/15	<b>02-37475-01</b> <sup>12</sup> <b>08-39129-01</b> <sup>13 35</sup>	<b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS 	<b>14-32276-01</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-37583-00</b> 06J 129 717 	<b>71-37511-00</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>81-37608-00</b> K ← 06H 103 085 G 45x60x8 AB SL RD FPM <b>81-90037-00</b> K → 06H 103 171 F PTFE	
1,8 CDA CDAB	112-118 kW (152-160 PS)	OCTAVIA TSI SUPERB TSI YETI TSI	06/07→	<b>02-37475-01</b> <sup>12</sup> <b>08-39129-01</b> <sup>13 35</sup>	<b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS 	<b>14-32276-01</b> 06D 103 385 D (10x)  <b>14-32383-01</b> WHT 005 305 (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-36072-00</b> 06F 129 717 D  <b>71-37583-00</b> 06J 129 717 	<b>71-37511-00</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>81-37608-00</b> K ← 06H 103 085 G 45x60x8 AB SL RD FPM <b>81-90037-00</b> K → 06H 103 171 F PTFE	
1,8 CEA [NEW]	118 kW (160 PS)			<b>02-37475-01</b> <sup>12</sup>	<b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS 	<b>14-32276-01</b> 06D 103 385 D (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-36072-00</b> 06F 129 717 D 	<b>71-37511-00</b> 06F 253 039 F 	<b>70-31414-10</b> 	<b>81-37608-00</b> K ← 06H 103 085 G 45x60x8 AB SL RD FPM	
1,8 CJA CJSB [NEW]	132 kW (180 PS)	OCTAVIA TSI	11/12→	<b>02-42165-02</b> <sup>12</sup> <b>08-10009-01</b> <sup>13</sup>	<b>61-42165-00</b> 06K 103 383 K 83 Ø MLS 	<b>14-32383-01</b> WHT 005 305 (10x) 	<b>70-31414-10</b> 	<b>12-31306-12</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-42786-00</b> 06K 129 717 A 	<b>71-42801-00</b> 06L 253 039 	<b>70-31414-10</b>  <b>71-10835-00</b> 06K 103 649 	<b>81-42737-00</b> K ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM <b>81-90081-00</b> K → 06K 103 171 A PTFE	

SKODA													
Ltr.													
1,9 AEF	47 kW (64 PS)	FELICIA D	10/95-04/02	<p><b>02-28777-03</b> <sup>12</sup></p> <p>028 198 012 E</p> <p><b>08-23134-03</b> <sup>13</sup></p> <p>028 198 011 D</p> <p>Mot.→AEF 265 000</p> <p><b>08-23134-04</b> <sup>13 35</sup></p> <p>Mot.AEF 265 001→</p>	<p><b>61-31225-30</b></p> <p>028 103 383 BH</p> <p>81 Ø</p> <p>1,53 mm 1 </p> <p>MLS</p> <p><b>61-31225-40</b></p> <p>028 103 383 BJ</p> <p>81 Ø</p> <p>1,57 mm 2 </p> <p>MLS</p> <p><b>61-31225-50</b></p> <p>028 103 383 BK</p> <p>81 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p>	<p><b>14-32047-01</b></p> <p>068 103 384 A (10x)</p>	<p><b>15-28777-01</b></p> <p>028 198 025</p>	<p><b>12-26058-02</b></p> <p>027 109 675 (8x)</p> <p><b>70-26058-00</b></p> <p>027 109 675</p>	<p><b>71-28781-10</b></p> <p>028 129 717 D</p> <p>8x </p>		<p><b>71-28451-00</b></p> <p>037 253 039</p>	<p><b>71-31943-00</b></p> <p>037 115 220 B</p>	<p><b>81-19299-10 K</b> ←</p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p> <p><b>81-23708-40 K</b> →</p> <p>068 103 051 P</p> <p>85x105x11</p> <p>A SL LD FPM</p> <p>Mot.→AEF 265 000</p> <p><b>81-90000-00 K</b> → </p> <p>028 103 171 B</p> <p>Mot.AEF 265 001→</p> <p><b>81-19299-10 N</b></p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p>
1,9 AEY	47 kW (64 PS)			<p><b>02-31257-02</b> <sup>12</sup></p> <p>028 198 012 F</p> <p><b>08-23134-03</b> <sup>13</sup></p> <p>028 198 011 D</p> <p>Mot.→AEY 050 000</p> <p><b>08-23134-04</b> <sup>13 35</sup></p> <p>Mot.AEY 050 001→</p>	<p><b>61-33120-30</b></p> <p>028 103 383 BL</p> <p>81 Ø</p> <p>1,45 mm 1 </p> <p>MLS</p> <p><b>61-33120-40</b></p> <p>028 103 383 BM</p> <p>81 Ø</p> <p>1,53 mm 2 </p> <p>MLS</p> <p><b>61-33120-50</b></p> <p>028 103 383 BN</p> <p>81 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p>	<p><b>14-32047-01</b></p> <p>068 103 384 A (10x)</p>	<p><b>15-31257-01</b></p> <p>028 103 483 G</p> <p>+028 103 532 A (3x)</p> <p>+028 103 533 (3x)</p>	<p><b>12-26058-02</b></p> <p>027 109 675 (8x)</p> <p><b>70-26058-00</b></p> <p>027 109 675</p>	<p><b>71-28781-10</b></p> <p>028 129 717 D</p> <p>8x </p>	<p><b>71-27898-20</b></p> <p>026 129 589 A</p> <p>4x </p>	<p><b>71-33138-00</b></p> <p>044 103 609 D</p> <p>Gummi</p>	<p><b>81-19299-10 K</b> ←</p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p> <p><b>81-23708-40 K</b> →</p> <p>068 103 051 P</p> <p>85x105x11</p> <p>A SL LD FPM</p> <p>Mot.→AEY 050 000</p> <p>028 103 171 B</p> <p>Mot.AEY 050 001→</p> <p><b>81-19299-10 N</b></p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p>	

SKODA													
Ltr.													
1,9 AGP	50 kW (68 PS)	OCTAVIA SDI	06/97-12/03	<p><b>02-33838-01</b> <sup>12</sup> 038 198 012</p> <p><del></del></p> <p><del></del></p> <p><b>08-31414-03</b> <sup>13</sup> <sup>38</sup> 038 198 011</p> <p><del></del></p>	<p><b>61-31325-00</b> 038 103 383 G 80,5 Ø 1,45 mm 1 </p> <p>MLS Mot.→AGP 028 000</p> <p><b>61-31325-10</b> 038 103 383 F 80,5 Ø 1,53 mm 2 </p> <p>MLS Mot.→AGP 028 000</p> <p><b>61-31325-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 </p> <p>MLS Mot.→AGP 028 000</p> <p></p> <p><b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 </p> <p>MLS Mot.AGP 028 001→</p> <p><b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 </p> <p>MLS Mot.AGP 028 001→</p> <p><b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS Mot.AGP 028 001→</p> <p></p>	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> <p></p>		<p><b>12-26058-02</b> 027 109 675 (8x)</p> <p><b>70-26058-00</b> 027 109 675</p>	<p><b>71-28781-10</b> 028 129 717 D</p> <p>8x </p>		<p><b>71-27898-20 R</b> 2x 026 129 589 A</p> <p></p> <p><b>71-28186-20 L</b> 2x 034 129 589 B</p> <p></p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90010-00 K</b> → </p> <p>06A 103 171 A PTFE</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>



SKODA												
Ltr.												
1,9 AGR	66 kW (90 PS)	OCTAVIA TDI	09/96-03/10	<p><b>02-33838-01</b> <sup>12</sup></p> <p>038 198 012</p> <p></p> <p></p> <p><b>08-31414-03</b> <sup>13 38</sup></p> <p>038 198 011</p> <p></p>	<p><b>61-31325-00</b></p> <p>038 103 383 G</p> <p>80,5 Ø</p> <p>1,45 mm 1 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p><b>61-31325-10</b></p> <p>038 103 383 F</p> <p>80,5 Ø</p> <p>1,53 mm 2 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p><b>61-31325-20</b></p> <p>038 103 383 E</p> <p>80,5 Ø</p> <p>1,61 mm 3 </p> <p>MLS</p> <p>Mot.→AGR 151 000</p> <p></p> <p><b>61-31980-00</b></p> <p>038 103 383 AL</p> <p>80,5 Ø</p> <p>1,47 mm 1 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p> <p><b>61-31980-10</b></p> <p>038 103 383 AM</p> <p>80,5 Ø</p> <p>1,57 mm 2 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p> <p><b>61-31980-20</b></p> <p>038 103 383 AN</p> <p>80,5 Ø</p> <p>1,67 mm 3 </p> <p>MLS</p> <p>Mot.AGR 151 001→</p> <p></p>	<p><b>14-32047-01</b></p> <p>068 103 384 A (10x)</p> <p></p>	<p><b>12-26058-02</b></p> <p>027 109 675 (8x)</p> <p><b>70-26058-00</b></p> <p>027 109 675</p>	<p><b>71-28781-10</b></p> <p>028 129 717 D</p> <p>8x </p>	<p><b>71-27898-20 R</b></p> <p>026 129 589 A</p> <p>2x </p> <p><b>71-28186-20 L</b></p> <p>034 129 589 B</p> <p>2x </p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>81-24292-10 K</b> ←</p> <p>054 115 147 B</p> <p>35x48x10</p> <p>A SL RD FPM</p> <p><b>81-90010-00 K</b> → </p> <p>06A 103 171 A</p> <p>PTFE</p> <p><b>81-19299-10 N</b></p> <p>068 103 085 E</p> <p>32x47x10</p> <p>A SL WD FPM</p>	

SKODA													
Ltr.	Power	Model	Year	Part 1	Part 2	Part 3	Part 4	Part 5	Part 6	Part 7	Part 8	Part 9	
1,9 AHF	81 kW (110 PS)	OCTAVIA TDI	08/97-01/06	<p><b>02-33838-01</b> <sup>12</sup> 038 198 012</p> <p></p> <p><b>08-31414-03</b> <sup>13 38</sup> 038 198 011</p> <p></p> <p></p>	<p><b>61-31325-00</b> 038 103 383 G 80,5 Ø 1,45 mm 1 </p> <p>MLS Mot.→AHF 140 000</p> <p><b>61-31325-10</b> 038 103 383 F 80,5 Ø 1,53 mm 2 </p> <p>MLS Mot.→AHF 140 000</p> <p><b>61-31325-20</b> 038 103 383 E 80,5 Ø 1,61 mm 3 </p> <p>MLS Mot.→AHF 140 000</p> <p></p> <p><b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 </p> <p>MLS Mot.AHF 140 001→</p> <p><b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 </p> <p>MLS Mot.AHF 140 001→</p> <p><b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS Mot.AHF 140 001→</p> <p></p>	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> <p></p>		<p><b>12-26058-02</b> 027 109 675 (8x)</p> <p><b>70-26058-00</b> 027 109 675</p>	<p><b>71-28781-10</b> 028 129 717 D</p> <p>8x </p>		<p><b>71-27898-20 R</b> 026 129 589 A</p> <p>2x </p> <p><b>71-28186-20 L</b> 034 129 589 B</p> <p>2x </p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90010-00 K</b> → </p> <p>06A 103 171 A PTFE</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>
1,9 ALH	66 kW (90 PS)	OCTAVIA TDI	09/96-03/10	<p><b>02-33838-01</b> <sup>12</sup> 038 198 012</p> <p></p> <p></p> <p><b>08-31414-03</b> <sup>13 38</sup> 038 198 011</p> <p></p>	<p><b>61-31980-00</b> 038 103 383 AL 80,5 Ø 1,47 mm 1 </p> <p>MLS</p> <p><b>61-31980-10</b> 038 103 383 AM 80,5 Ø 1,57 mm 2 </p> <p>MLS</p> <p><b>61-31980-20</b> 038 103 383 AN 80,5 Ø 1,67 mm 3 </p> <p>MLS</p> <p></p>	<p><b>14-32047-01</b> 068 103 384 A (10x)</p> <p></p>		<p><b>12-26058-02</b> 027 109 675 (8x)</p> <p><b>70-26058-00</b> 027 109 675</p>	<p><b>71-28781-10</b> 028 129 717 D</p> <p>8x </p>		<p><b>71-27898-20 R</b> 026 129 589 A</p> <p>2x </p> <p><b>71-28186-20 L</b> 034 129 589 B</p> <p>2x </p>	<p><b>70-31414-10</b></p> <p></p>	<p><b>81-24292-10 K</b> ← 054 115 147 B 35x48x10 A SL RD FPM</p> <p><b>81-90010-00 K</b> → </p> <p>06A 103 171 A PTFE</p> <p><b>81-19299-10 N</b> 068 103 085 E 32x47x10 A SL WD FPM</p>

SKODA												
Ltr.												
1,9 AQM 50 kW (68 PS)	OCTAVIA SDI	06/97-12/03	 02-33838-02 <sup>12</sup>  08-31414-03 <sup>13 38</sup> 	 61-31980-00 038 103 383 AL 80,5 Ø 1,47 mm 1 MLS 61-31980-10 038 103 383 AM 80,5 Ø 1,57 mm 2 MLS 61-31980-20 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS 	 14-32047-01 068 103 384 A (10x) 		 12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675	 71-28781-10 028 129 717 D 8x		 71-31957-00 037 253 039 D 71-27909-10 155 253 115 	 70-31414-10 	 81-24292-10 K ← 054 115 147 B 35x48x10 A SL RD FPM 81-90010-00 K → 06A 103 171 A PTFE 81-19299-10 N 068 103 085 E 32x47x10 A SL WD FPM
1,9 ASV 81 kW (110 PS)	OCTAVIA TDI	08/97-01/06	 02-33838-01 <sup>12</sup> 038 198 012  08-31414-03 <sup>13 38</sup> 038 198 011 	 61-31980-00 038 103 383 AL 80,5 Ø 1,47 mm 1 MLS 61-31980-10 038 103 383 AM 80,5 Ø 1,57 mm 2 MLS 61-31980-20 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS 	 14-32047-01 068 103 384 A (10x) 		 12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675	 71-28781-10 028 129 717 D 8x	 71-27898-20 R 2x 026 129 589 A 71-28186-20 L 2x 034 129 589 B 71-31957-00 037 253 039 D 71-33841-00 3A0 253 115 	 70-31414-10 	 81-24292-10 K ← 054 115 147 B 35x48x10 A SL RD FPM 81-90010-00 K → 06A 103 171 A PTFE 81-19299-10 N 068 103 085 E 32x47x10 A SL WD FPM	
1,9 ASY 47 kW (64 PS)	FABIA SDI	11/99-03/08	 02-34302-02 <sup>12</sup>  08-35038-01 <sup>13 35</sup> 	 61-31980-00 038 103 383 AL 80,5 Ø 1,47 mm 1 MLS 61-31980-10 038 103 383 AM 80,5 Ø 1,57 mm 2 MLS 61-31980-20 038 103 383 AN 80,5 Ø 1,67 mm 3 MLS 	 14-32047-01 068 103 384 A (10x) 		 12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675	 71-28781-10 028 129 717 D 8x	 71-27898-20 L 2x 026 129 589 A 71-28186-20 R 2x 034 129 589 B 71-27909-10 155 253 115 	 70-31414-10 	 81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90010-00 K → 06A 103 171 A PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM	



SKODA												
1.9 ASZ ATD AXR	74-96 kW (100-130 PS)	FABIA TDI OCTAVIA TDI ROOMSTER TDI	01/00-12/10	<p>02-34302-01 <sup>12</sup></p> <p>08-35038-01 <sup>13 35</sup></p>	<p>61-34250-00 038 103 383 DE 81 Ø 1,45 mm 1 <input type="checkbox"/> MLS 61-34250-10 038 103 383 DF 81 Ø 1,53 mm 2 <input type="checkbox"/> MLS 61-34250-20 038 103 383 DG 81 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p>14-32121-01 038 103 384 (10x)</p>	<p>71-35884-00 038 103 483 D</p>	<p>12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675</p>	<p>71-28781-10 028 129 717 D</p> <p>8x </p>	<p>71-27898-20 R 2x 026 129 589 A</p> <p>71-28186-20 L 2x 034 129 589 B</p> <p>71-33841-00 <sup>A</sup> 3A0 253 115</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90010-00 K → <sup>A</sup> 06A 103 171 A PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
1.9 AVB AVF AWX BLT BPZ BSV BSW	74-96 kW (101-130 PS)	FABIA TDI ROOMSTER SUPERB TDI	12/01-03/10	<p>02-34302-01 <sup>12</sup></p> <p>08-35038-01 <sup>13 35</sup></p>	<p>61-34250-00 038 103 383 DE 81 Ø 1,45 mm 1 <input type="checkbox"/> MLS 61-34250-10 038 103 383 DF 81 Ø 1,53 mm 2 <input type="checkbox"/> MLS 61-34250-20 038 103 383 DG 81 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p>14-32121-01 038 103 384 (10x)</p>	<p>71-35884-00 038 103 483 D</p>	<p>12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675</p>	<p>71-28781-10 028 129 717 D</p> <p>8x </p>	<p>71-31957-00 037 253 039 D</p> <p>71-33841-00 <sup>A</sup> 3A0 253 115</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90010-00 K → <sup>A</sup> 06A 103 171 A PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
1.9 BJB BKC BXE	77 kW (105 PS)	OCTAVIA TDI SUPERB TDI	06/04-12/10	<p>02-34302-01 <sup>12</sup></p> <p>08-35038-02 <sup>13 35</sup></p>	<p>61-34250-00 038 103 383 DE 81 Ø 1,45 mm 1 <input type="checkbox"/> MLS 61-34250-10 038 103 383 DF 81 Ø 1,53 mm 2 <input type="checkbox"/> MLS 61-34250-20 038 103 383 DG 81 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p>14-32121-01 038 103 384 (10x)</p>	<p>71-35884-00 038 103 483 D</p>	<p>12-26058-02 027 109 675 (8x) 70-26058-00 027 109 675</p>	<p>71-28781-10 028 129 717 D</p> <p>8x </p>	<p>71-31957-00 037 253 039 D</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-90018-00 K → <sup>A</sup> 038 103 171 S PTFE 81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>

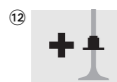



































SKODA													
1.9 BLS	77 kW (105 PS)	FABIA TDI OCTAVIA TDI ROOMSTER SUPERB TDI	06/04-12/10	 <b>02-37594-01</b> <sup>12</sup>  <b>08-35038-02</b> <sup>13 35</sup>	<b>61-34250-00</b> 038 103 383 DE 81 Ø 1,45 mm 1 MLS <b>61-34250-10</b> 038 103 383 DF 81 Ø 1,53 mm 2 MLS <b>61-34250-20</b> 038 103 383 DG 81 Ø 1,61 mm 3 MLS 	<b>14-32121-01</b> 038 103 384 (10x) 	<b>71-37594-00</b> 03G 103 483 D 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-28781-10</b> 028 129 717 D 8x 		<b>71-37533-00</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90018-00</b> K → 038 103 171 S PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2.0 AEG	85 kW (116 PS)	OCTAVIA	04/99-05/07	<b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-34212-00</b> 06A 103 483 C 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>40-76854-00</b> 4x 06A 129 717 D 		<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2.0 APK AQY AZH	85 kW (116 PS)	OCTAVIA	04/99-05/07	<b>02-34140-02</b> <sup>12</sup> <b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-31691-00</b> 051 103 483 A 2 Dichtlippen 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-31983-00</b> 8x 037 129 717 C  <b>71-34222-00</b> <sup>10</sup> 06A 129 717 		<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2.0 AZJ	85 kW (116 PS)	OCTAVIA	04/99-05/07	<b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-34212-00</b> 06A 103 483 C 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-34203-00</b> 4x 06A 133 398 F  <b>71-36061-00</b> <sup>10</sup> 4x 06A 133 227 B 		<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM
2.0 AZL	85 kW (116 PS)	FABIA	12/99-03/08	<b>02-34140-03</b> <sup>12</sup> <b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-34212-00</b> 06A 103 483 C 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675	<b>71-31983-00</b> 8x 037 129 717 C  <b>71-34222-00</b> <sup>10</sup> 06A 129 717 		<b>71-34216-00</b> 06A 253 039 L 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM

SKODA													
2,0 AZM	85 kW (115 PS)	SUPERB	12/01-03/08	 <b>02-34140-01</b> <sup>12</sup> <b>08-35038-01</b> <sup>13 35</sup>	<b>61-34140-10</b> 06A 103 383 AN MLS 	<b>14-32126-01</b> 06A 103 384 C (10x) 	<b>71-31691-00</b> 051 103 483 A 2 Dichtlippen 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675 8x 	<b>71-34208-00</b> 06B 129 717 A 4x 	<b>71-31957-00</b> 037 253 039 D 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90010-00</b> K → 06A 103 171 A PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
2,0 AZV BKD	100-103 kW (136-140 PS)	OCTAVIA TDI SUPERB TDI	02/04-05/15	 <b>02-36041-01</b> <sup>12</sup>  <b>08-35038-02</b> <sup>13 35</sup>	<b>61-33770-00</b> 03G 103 383 82 Ø 1,55 mm 1 MLS <b>61-33770-10</b> 03G 103 383 A 82 Ø 1,63 mm 2 MLS <b>61-33770-20</b> 03G 103 383 B 82 Ø 1,71 mm 3 MLS	<b>14-32195-01</b> 03G 103 384 (10x) 	<b>71-36041-00</b> 03G 103 483 	<b>12-31306-01</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-36121-00</b> 03G 129 717 B 16x  <b>71-37563-00</b> 03G 129 717 C 	<b>71-38428-00</b> 03L 253 039 B 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90018-00</b> K → 038 103 171 S PTFE <b>81-34367-00</b> N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM	
2,0 BLR BLX BLY BVX BZY BVZ	110 kW (150 PS)	OCTAVIA FSI	11/04-10/08	<b>02-36030-02</b> <sup>12</sup> <b>08-35053-04</b> <sup>13 38</sup>	<b>61-36030-00</b> 06D 103 383 L MLS 	<b>14-32197-01</b> 06D 103 385 (10x) 	<b>71-36047-00</b> 06D 103 483 E 	<b>12-31306-01</b> 036 109 675 (16x) <b>70-31306-00</b> 036 109 675 16x 	<b>71-36071-00</b> 06D 129 717 D 16x 	<b>71-34214-00</b> 06B 253 039 E 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90006-00</b> K → 06B 103 171 B PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM	
2,0 BMM BMP	103 kW (140 PS)	OCTAVIA TDI SUPERB TDI	11/05-05/10	 <b>02-37594-01</b> <sup>12</sup>  <b>08-35038-02</b> <sup>13 35</sup>	<b>61-34810-00</b> 038 103 383 CP 82 Ø 1,45 mm 1 MLS <b>61-34810-10</b> 038 103 383 CQ 82 Ø 1,53 mm 2 MLS <b>61-34810-20</b> 038 103 383 CR 82 Ø 1,61 mm 3 MLS	<b>14-32121-01</b> 038 103 384 (10x) 	<b>71-37594-00</b> 03G 103 483 D 	<b>12-26058-02</b> 027 109 675 (8x) <b>70-26058-00</b> 027 109 675 8x 	<b>71-28781-10</b> 028 129 717 D 8x 	<b>71-37533-00</b> 03G 253 039 A 	<b>70-31414-10</b> 	<b>81-34366-00</b> K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM <b>81-90018-00</b> K → 038 103 171 S PTFE <b>81-34367-00</b> N 038 103 085 A 32x47x10 A SL RD PTFE ACM	

SKODA													
Ltr.	Power	Model	Year	Part 1	Part 2	Part 3	Part 4	Part 5	Part 6	Part 7	Part 8	Part 9	
2,0 BMN	125 kW (170 PS)	OCTAVIA TDI	04/06-02/13	<p>02-36972-01 <sup>12</sup></p> <p>08-35038-02 <sup>13 35</sup></p>	<p>61-33770-00 03G 103 383 82 Ø 1,55 mm 1 <input type="checkbox"/> MLS</p> <p>61-33770-10 03G 103 383 A 82 Ø 1,63 mm 2 <input type="checkbox"/> MLS</p> <p>61-33770-20 03G 103 383 B 82 Ø 1,71 mm 3 <input type="checkbox"/> MLS</p>	<p>14-32195-01 03G 103 384 (10x)</p>	<p>71-36972-00 03G 103 483 C</p>	<p>12-31306-01 036 109 675 (16x)</p> <p>70-31306-00 036 109 675</p>	<p>71-36121-00 03G 129 717 B</p> <p>16x</p> <p>71-37563-00 03G 129 717 C</p>		<p>71-38429-00 03G 253 039 E</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90018-00 K → </p> <p>038 103 171 S PTFE</p> <p>81-34367-00 N 2x 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 BSS BWW	91-103 kW (124-140 PS)	SUPERB TDI	10/05→	<p>02-34302-01 <sup>12</sup></p> <p>08-35038-01 <sup>13 35</sup></p>	<p>61-34810-00 038 103 383 CP 82 Ø 1,45 mm 1 <input type="checkbox"/> MLS</p> <p>61-34810-10 038 103 383 CQ 82 Ø 1,53 mm 2 <input type="checkbox"/> MLS</p> <p>61-34810-20 038 103 383 CR 82 Ø 1,61 mm 3 <input type="checkbox"/> MLS</p>	<p>14-32121-01 038 103 384 (10x)</p>	<p>71-35884-00 038 103 483 D</p>	<p>12-26058-02 027 109 675 (8x)</p> <p>70-26058-00 027 109 675</p>	<p>71-28781-10 028 129 717 D</p> <p>8x</p>		<p>71-31957-00 037 253 039 D</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90010-00 K → </p> <p>06A 103 171 A PTFE</p> <p>81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 BWA	147 kW (200 PS)	OCTAVIA RS	10/05-02/13	<p>02-36005-01 <sup>12</sup></p> <p>08-35054-02 <sup>13 35</sup></p>	<p>61-36005-00 06F 103 383 G MLS</p>	<p>14-32276-01 06D 103 385 D (10x)</p>	<p>71-36774-00 06F 103 483 D</p>	<p>12-31306-12 036 109 675 (16x)</p> <p>70-31306-00 036 109 675</p>	<p>71-36072-00 06F 129 717 D</p> <p>16x</p>		<p>71-37511-00 06F 253 039 F</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90010-00 K → </p> <p>06A 103 171 A PTFE</p> <p>81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 BXX CGZ CGZA <b>[NEW]</b>	85-88 kW (116-120 PS)			<p>02-34140-03 <sup>12</sup></p> <p>08-35038-01 <sup>13 35</sup></p>	<p>61-34140-10 06A 103 383 AN MLS</p>	<p>14-32126-01 06A 103 384 C (10x)</p>	<p>71-34212-00 06A 103 483 C</p>	<p>12-26058-02 027 109 675 (8x)</p> <p>70-26058-00 027 109 675</p>	<p>40-76854-00 4x</p> <p>8x</p>		<p>71-34216-00 06A 253 039 L</p>	<p>70-31414-10</p>	<p>81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p>81-90010-00 K → </p> <p>06A 103 171 A PTFE</p> <p>81-34367-00 N 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>

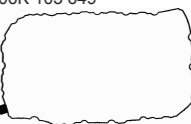SKODA												
2,0 CBBB CBDB CEGA	103-125 kW (140-170 PS)	OCTAVIA TDI SUPERB TDI YETI TDI	04/06→	<p> 02-38931-01 <sup>12</sup></p> <p> 08-39084-01 <sup>13 35</sup></p>	<p><b>61-38190-00</b> 03L 103 383 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-38190-10</b> 03L 103 383 A 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-38190-20</b> 03L 103 383 B 82 Ø 1,71 mm 3 </p> <p>MLS</p>	<p><b>14-32299-01</b> WHT 002 131 (10x)</p>	<p><b>71-38931-00</b> 03L 103 483</p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-10510-00</b> 03L 129 717 B</p> <p>16x </p> <p><b>71-38929-00</b> 03L 129 717</p>	<p><b>71-38428-00</b> 03L 253 039 B</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-34367-00 N</b> 038 103 085 A 32x47x10 A SL RD PTFE ACM</p>
2,0 CCZA	147 kW (200 PS)	OCTAVIA RS SUPERB TSI	10/05-05/15	<p> 02-37475-01 <sup>12</sup></p> <p> 08-39129-01 <sup>13 35</sup></p>	<p><b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS</p>	<p><b>14-32276-01</b> 06D 103 385 D (10x)</p>	<p><b>70-31414-10</b></p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-36072-00</b> 06F 129 717 D</p> <p>16x </p>	<p><b>71-37511-00</b> 06F 253 039 F</p>	<p><b>70-31414-10</b></p>	<p><b>81-37608-00 K</b> ← 06H 103 085 G 45x60x8 AB SL RD FPM</p> <p><b>81-90037-00 K</b> → </p> <p>06H 103 171 F PTFE</p>
2,0 CFFB CFHA CFHC CFHF CLCA CLCB CLJA	81-103 kW (110-140 PS)	OCTAVIA TDI SUPERB TDI YETI TDI	02/04→	<p> 02-40486-01 <sup>12</sup></p> <p> 08-40848-01 <sup>13 35</sup></p>	<p><b>61-37600-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-37600-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-37600-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 </p> <p>MLS</p>	<p><b>14-32299-01</b> WHT 002 131 (10x)</p>	<p><b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)</p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-40507-00</b> 03L 129 717 E</p> <p>16x </p>	<p><b>71-37422-00</b> 03L 253 039 E</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>
2,0 CFGB	125 kW (170 PS)	SUPERB TDI	07/08-05/15	<p> 02-40486-04 <sup>12</sup></p> <p> 08-40848-02 <sup>13 38</sup></p>	<p><b>61-37600-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-37600-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-37600-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 </p> <p>MLS</p>	<p><b>14-32299-01</b> WHT 002 131 (10x)</p>	<p><b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)</p>	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-40507-00</b> 03L 129 717 E</p> <p>16x </p>	<p><b>71-42823-00</b> 04L 253 039 D</p>	<p><b>70-31414-10</b></p>	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>

SKODA													
Ltr.													
2,0 CFJA 125 kW (170 PS)	YETI TDI	11/09→	<p><b>02-40486-01</b> <sup>12</sup> →11/12</p>  <p><b>02-40486-04</b> <sup>12</sup> 12/12→</p>  <p><b>08-40848-01</b> <sup>13 35</sup></p>	<p><b>61-37600-00</b> 03L 103 383 BM 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-37600-10</b> 03L 103 383 BN 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-37600-20</b> 03L 103 383 BP 82 Ø 1,71 mm 3 </p> <p>MLS</p> 	<p><b>14-32299-01</b> WHT 002 131 (10x)</p> 	<p><b>15-40486-01</b> 03L 103 483 C +03L 103 070 (4x)</p>  <p><b>71-40486-00</b> 03L 103 483 C</p> 	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-40507-00</b> 03L 129 717 E</p> <p>16x </p>		<p><b>71-37422-00</b> 03L 253 039 E →11/12</p>  <p><b>71-42823-00</b> 04L 253 039 D 12/12→</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-34366-00 K</b> ← 038 103 085 E 35x48x10 A SL RD PTFE ACM</p> <p><b>81-90052-00 K</b> → </p> <p>03L 103 171 A PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>	
2,0 CGM CGMA <b>[NEW]</b>	147 kW (200 PS)		<p><b>02-37475-01</b> <sup>12</sup></p>	<p><b>61-37475-00</b> 06H 103 383 AD 83 Ø MLS</p> 	<p><b>14-32276-01</b> 06D 103 385 D (10x)</p> 	<p><b>70-31414-10</b></p> 	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-36072-00</b> 06F 129 717 D</p> <p>16x </p>		<p><b>71-37511-00</b> 06F 253 039 F</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-37608-00 K</b> ← 06H 103 085 G 45x60x8 AB SL RD FPM</p>	
2,0 CHHB <b>[NEW]</b>	162 kW (220 PS)	OCTAVIA TSI SUPERB TSI	11/12→	<p><b>02-42165-02</b> <sup>12</sup></p> <p><b>08-10009-01</b> <sup>13</sup></p>	<p><b>61-42165-00</b> 06K 103 383 K 83 Ø MLS</p> 	<p><b>14-32383-01</b> WHT 005 305 (10x)</p> 	<p><b>70-31414-10</b></p> 	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-42786-00</b> 06K 129 717 A</p> <p>16x </p>		<p><b>71-42801-00</b> 06L 253 039</p> 	<p><b>70-31414-10</b></p>  <p><b>71-10835-00</b> 06K 103 649</p> 	<p><b>81-42737-00 K</b> ← 06L 103 085 B 45x60x8 A SL RD PTFE ACM</p> <p><b>81-90081-00 K</b> → </p> <p>06K 103 171 A PTFE</p>
2,0 CKFB CKFC CRMB CUNA CUPA <b>[NEW]</b>	105-135 kW (143-184 PS)	OCTAVIA TDI	11/12→	<p><b>02-10002-01</b> <sup>12</sup></p>  	<p><b>61-38280-00</b> 04L 103 383 BJ 82 Ø 1,55 mm 1 </p> <p>MLS</p> <p><b>61-38280-10</b> 04L 103 383 BK 82 Ø 1,63 mm 2 </p> <p>MLS</p> <p><b>61-38280-20</b> 04L 103 383 BL 82 Ø 1,71 mm 3 </p> <p>MLS</p> 	<p><b>14-32384-01</b> WHT 005 673 (10x)</p> 	<p><b>15-10836-01</b> 04L 103 483 +04L 103 070 A (4x)</p>  <p><b>15-42759-01</b> 03L 103 483 S +04L 103 070 (4x)</p>  <p><b>71-10836-00</b> 04L 103 483</p>  <p><b>71-42759-00</b> 03L 103 483 S</p> 	<p><b>12-31306-12</b> 036 109 675 (16x)</p> <p><b>70-31306-00</b> 036 109 675</p>	<p><b>71-42811-00</b> 04L 129 717 B</p> <p>16x </p>		<p><b>71-42816-00</b> 04L 253 039 G</p> 	<p><b>70-31414-10</b></p> 	<p><b>81-42306-00 K</b> → </p> <p>04L 103 171 PTFE</p> <p><b>81-40538-00 N</b> 03L 103 085 32x47x10 A RD FPM</p>

SKODA													
2,0 CRVC <b>[NEW]</b>	105 kW (143 PS)	OCTAVIA TDI	11/12→	 02-10002-02 <sup>12</sup>  08-31717-01 <sup>13</sup>	61-38280-00 04L 103 383 BJ 82 Ø 1,55 mm 1 <input type="checkbox"/> MLS 61-38280-10 04L 103 383 BK 82 Ø 1,63 mm 2 <input type="checkbox"/> MLS 61-38280-20 04L 103 383 BL 82 Ø 1,71 mm 3 <input type="checkbox"/> MLS 	14-32384-01 WHT 005 673 (10x) 	15-10836-01 04L 103 483 +04L 103 070 A (4X)  15-42759-01 03L 103 483 S +04L 103 070 (4x)  71-10836-00 04L 103 483  71-42759-00 03L 103 483 S 	12-31306-12 036 109 675 (16x) 70-31306-00 036 109 675	71-42811-00 04L 129 717 B 16x 	71-42823-00 04L 253 039 D 	70-31414-10 	81-42306-00 K → 04L 103 171 PTFE 81-40538-00 N 03L 103 085 32x47x10 ARD FPM	
2,5 AYM	114 kW (155 PS)	SUPERB TDI	12/01-08/03	 02-34088-01 <sup>12</sup>  08-31717-01 <sup>13</sup>	2x 61-34145-00 059 103 383 BQ 79 Ø 1,1 mm 1 <input type="checkbox"/> MLS 61-34145-10 059 103 383 BR 79 Ø 1,15 mm 2 <input type="checkbox"/> MLS 61-34145-20 059 103 383 BS 79 Ø 1,2 mm 3 <input type="checkbox"/> MLS 	2x 14-32059-02 059 103 384 (8x) 	2x 15-34088-01 059 198 025 	2x 12-31306-08 036 109 675 (12x) 70-31306-00 036 109 675	2x 71-34082-00 059 129 717 G 24x 	6x 71-34084-00 059 253 039 B 	6x 70-31414-10 	81-24292-10 K ← 054 115 147 B 35x48x10 A SL RD FPM 81-19299-10 K → 068 103 085 E 32x47x10 A SL WD FPM 81-35916-00 K → 070 103 051 A 85x105x12 A SL LD PTFE ACM	
2,5 BDG	120 kW (163 PS)	SUPERB TDI	06/03-03/08	 02-34088-01 <sup>12</sup>  08-31717-01 <sup>13</sup>	2x 61-34145-00 059 103 383 BQ 79 Ø 1,1 mm 1 <input type="checkbox"/> MLS 61-34145-10 059 103 383 BR 79 Ø 1,15 mm 2 <input type="checkbox"/> MLS 61-34145-20 059 103 383 BS 79 Ø 1,2 mm 3 <input type="checkbox"/> MLS 	2x 14-32196-01 057 103 384 A (8x) 	2x 15-34088-01 059 198 025 	2x 12-31306-08 036 109 675 (12x) 70-31306-00 036 109 675	2x 71-34082-00 059 129 717 G 24x 	6x 71-34084-00 059 253 039 B 	6x 70-31414-10 	81-24292-10 K ← 054 115 147 B 35x48x10 A SL RD FPM 81-19299-10 K → 068 103 085 E 32x47x10 A SL WD FPM 81-35916-00 K → 070 103 051 A 85x105x12 A SL LD PTFE ACM	
2,8 AMX BBG	140-142 kW (190-193 PS)	SUPERB SUPERB V6	12/01-03/08	02-31875-02 078 198 012 F +068 103 085 E (2x) 15-34364-01 <sup>8</sup> 058 198 217	2x 61-31875-00 078 103 383 L 83,5 Ø 2x MLS 	2x 14-32125-02 078 103 385 K (8x) 	2x 15-31798-01 078 198 025 	2x 12-31306-10 036 109 675 (15x) 70-31306-00 036 109 675	2x 71-31801-00 078 129 717 J 30x 	2x 71-34047-00 078 253 039 G 	2x 70-31414-10 	81-34366-00 K ← 038 103 085 E 35x48x10 A SL RD PTFE ACM 81-19299-10 N 4x 068 103 085 E 32x47x10 A SL WD FPM	

SKODA														
Ltr.														
3,6 CDVA	191 kW (260 PS)	SUPERB	11/08-05/15	02-36430-02 <sup>12</sup> 08-10007-01 <sup>13</sup>	61-36430-00 03H 103 383 H 85 Ø MLS 	14-32275-01 WHT 000 497 A (13x) +WHT 000 789 A (7x) 	71-37556-00 03H 103 483 C 	12-31306-05 036 109 675 (24x) 70-31306-00 036 109 675	71-39051-00 03H 133 237 D 24x		71-39042-00 03H 253 039 H Zyl. 1-3 	71-39043-00 03H 253 050 D Zyl. 4-6 	70-31414-10 	81-34819-00 K → 021 103 051 C 85x105x11 A SL LD PTFE ACM